

C A L I F O R N I A A C C E N T L I G H T I N G I N C

## ALS**500T-MC-1**

INSTALLATION


## Perspective View



where each mounting clip will be installed along reference line.

2. Use 1 mounting clip every 2', rounded up.

**Example 1:** Individual run of 7'8".




1. Measure area where luminaire will be installed. Use a laser line to create a reference line

along installation area, ensuring consistent alignment of mounting clips. Mark location

**Example 2:** Continuous run of 10'6" (4' + 4' + 2'6").


Use a mounting clip at the joint between luminaire segments.




 Lay mounting clips along reference line and pre-drill using an appropriate drill bit for surface and screw size. Recommended: 8/32 x 1" screw.

**Note:** Allow 0.25" clearance for lateral expansion of assembled mounting clips. Only install mounting clips on flat, even surfaces.

**4.** Screw mounting clips to surface, then snap luminaire into mounting clips.




Install set screws into mounting clips for outward and downward facing applications. Install set screws on each mounting clip that connects two fixtures.

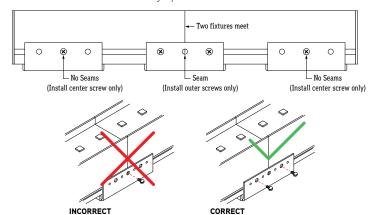


Install outer screws on each side of mounting clip at seam

Do not install center screw at seam

Assembled End Views



Clear Lens



Semi-Frosted Lens Frosted Lens

## CALIFORNIA ACCENT LIGHTING, INC.

2820 E. Gretta Lane, Anaheim, CA 92806 ph. 800.921.CALI (2254) | fx. 714.535.7902 | info@calilighting.com | calilighting.com © CALI. All rights reserved. CALI reserves the right to make changes or withdraw specifications without prior notice.

This document is issued in strict confidence on condition that it is not used as a basis for manufacture or sale and is not copied, reprinted, or disclosed to a third party either wholly or in part without the prior written consent of California Accent Lighting, Inc.



